

2

# Polk County Fire Rescue

## Post Incident Analysis



Residential Structure Fire

With Entrapment

13802 Rock Ridge Road, Lakeland, FL

Alarm # 1887368

November 23<sup>rd</sup>, 2018

19:06:54

# Battalion 1

*This report is intended to serve as a safety and training tool. Information contained herein is subject to revision as further investigation is conducted and additional information is developed.*

Prepared by: Battalion Chief Jeremiah Gilley      Date: 12/06/2018

## Contents

Incident Data .....	4
Executive Summary .....	4
Benchmarks .....	5
Accountability:.....	5
Initial strategy:.....	5
Staffing: .....	5
Safety Officer:.....	5
Rehab:.....	5
Tactics / Strategy .....	6
Size up: .....	6
Risk assessment:.....	6
Identification of Hazards: .....	6
Water Supply:.....	6
Search/Rescue:.....	6
Staging: .....	6
Exposures: .....	6
Occupant Services: .....	6
Patient Care:.....	6
Command / Control.....	6
Effectiveness of Command Structure:.....	6
Transition from Offense to Defense:.....	7
Use of Mutual Aid:.....	7
Use of Staff Support: .....	7
Interface with other Agencies: .....	7
Communications .....	7

Effectiveness of Communication Structure:.....7  
Tactical Channels:.....7  
Communications Concerns / Areas of Improvement:.....7  
Communication Interface with Other Agencies:.....8  
Lessons Learned: .....8  
    Things that went well: .....8  
    Things that could have been done better: .....8  
    An area for global training and improvement:.....9  
Additional .....10  
    Identified need for improved resources: .....10  
Appendix .....11

## Incident Data

Incident Date:

November 23<sup>rd</sup>, 2018

Incident Report Number:

1887368

Alarm Time:

19:06:54

Incident Location:

13802 Rock Ridge Road

Polk County Fire Rescue Units Responding:

Engine 6, Engine 23, Engine 39, Squad 7, Rescue 6, Brush 23, Medic 231, Battalion 1, Battalion 3, Tender 39, Tender 15, Tender 4, Air Truck 19, Chief 506.

Mutual Aid Units Responding:

Auburndale Fire Department Tender 4.

Type of Incident:

Residential Structure Fire with entrapment.

Weather:

Warm, dry, no precipitation.

Response delays:

No response delays noted. E-23 had a faster response time because they were already traveling to another call closer to this call than their station is. They were near Kathleen Middle School when the call came in.

### Executive Summary

A residential structure fire occurred at this address. The home was a wood frame log cabin. One occupant of the residence perished in the fire. The fire origin and cause remains undetermined at this time and is under investigation by the State Fire Marshal's Office. The structure was inhabited and served as the home for two people. The structure did have power. There were no hydrants in the area. Access to the structure was blocked by overgrown trees and an uneven and unpaved dirt roadway.

This emergency call had several components which led to it being the "perfect storm". To begin, it was a predominantly wood frame structure located in a remote urban/rural interface without water supply. The occupant of the home was not readily ambulatory, and the first call for help was made to a family member and not to 911, which ultimately delayed emergency response.



The view of the home was hidden from the street by the woods and there was not a visible numerical address. The road access to the home was also overgrown with trees and the road itself is most likely unpassable by a typical fire apparatus even if the trees had been trimmed back. Any type of residential firefighting operations with an obstacle of performing operations with the closest apparatus parking 300 to 400 feet away has a higher probability for a poor outcome.

Evidence suggests the home did not have working smoke detectors, because none were heard in the background of the twenty minute intake call recorded by Dispatch. The residence also had several (10 or more) trees close to or touching the house. This further hid the fire and structure from the roadway and hampered firefighting operations.

## Benchmarks

### Accountability:

Accountability initially was overseen by Captain 6, James Williams, who assumed Command of the scene upon his arrival and established accountability on the Alpha side of the structure at Engine 6 (side facing the driveway to the home). Accountability was taken over by Battalion 3, Yevgeniy Gorokhov, shortly after his arrival.

### Initial strategy:

A defensive fire attack was initiated by the first on scene Captain, James Williams, and his engine crew. Captain Williams reported a working fire in the structure so heavily involved he did not feel entering the structure was safe. Furthermore he reported active and fallen power lines on the Alpha/Delta side of the structure which would have prohibited access and hindered doing a walk around of the entire structure. The defensive attack utilized by Captain Williams consisted of deploying a courtyard lay of 300 feet of 2.5" hose to a gated wye and then reducing down to a 1 and 3/4" handline. The courtyard lay was deployed down the driveway. A second handline was later added once a sufficient water supply was established with the use of Tender trucks. The closest hydrant to this address is over five (5) miles away.

### Staffing:

Two battalion chiefs, three engines, one squad, one medic unit, one rescue, four tenders, an air truck, a medic unit, and one brush truck responded to the scene for a total of 18 firefighters and two single-cert. employees

### Safety Officer:

Safety functions were overseen by Command using Bluecard protocol. Accountability was overseen by Command, (James Williams initially) and then taken over by Battalion 3, Yevgeniy Gorokhov, for the duration of the call. No Safety Officer responded to this call.

### Rehab:

Medic 231 established Rehab per orders from Incident Command.

## Tactics / Strategy

### Size up:

Initial incident was identified as a working fire in a residential structure with reported entrapment. Heavy smoke and flames were showing from multiple points of the residence.

### Risk assessment:

The initial on scene Captain and commanding officer, Captain 6 (James Williams), deemed the risk to enter the structure to attempt a rescue too dangerous. His initial tactical decisions focused predominantly with the choice to go defensive (no entry into structure) and establish a hoseline for a defensive fire attack.

### Identification of Hazards:

First arriving officer, Captain 6 (James Williams), reported IDLH atmosphere was immediately present upon arrival with heavy smoke and flame conditions in the structure which would also affect visibility. He further reported active fallen power lines adjacent to the structure.

### Water Supply:

A water source with a dump tank and tender operations was set up as a water supply because there were no hydrants.

### Search/Rescue:

Search and Rescue was not performed by the first arriving engine crew because the structure was deemed too dangerous and unstable by Captain 6 to enter. A primary search of the structure was performed once the fire was under control and mostly extinguished.

### Staging:

Apparatus staging was initially established on Rock Ridge Road. No Staging Officer was utilized. The only units staging were Tenders and water supply needs controlled and dictated their arrivals and departures to and from the scene.

### Exposures:

Some residential exposures were noted in the immediate adjacent properties, however, none were ever threatened by this fire due to their distance away. Crews did deal with the wildland interface exposure fires created by the structure fire and extinguished those various fires with Brush 23.

### Occupant Services:

N/A

### Patient Care:

No patients were treated or transported from this scene.

## Command / Control

### Effectiveness of Command Structure:

Staff build up at the scene transitioned and instituted an organized command structure suitable for the scope of the event.

#### Transition from Offense to Defense:

Captain 6, James Williams, operated from a defensive strategy, and a defensive strategy only, subsequent to his size up of the scene.

#### Use of Mutual Aid:

Auburndale Fire Department supplied a tender per our mutual aid request.

#### Use of Staff Support:

Chief 506, Raf Vittone, responded to the scene as staff officer representative and support. He gave approval for the purchase of nourishment for the crews.

#### Interface with other Agencies:

Polk County Sheriff's Office was crucial for scene preservation, traffic control, scene access, and crime scene operations. State Fire Marshal's Office was notified early in the scene while firefighting operations were still underway.

## Communications

#### Effectiveness of Communication Structure:

There were no issues with the Communication Structure of the event. Units were placed on a designated Tac channel and radio operations worked as expected.

#### Tactical Channels:

This was a two day event. Tac channel 8 was utilized for response and command/operational communication with assigned units.

#### Communications Concerns / Areas of Improvement:

Dispatch did not relay exact information as it was received from the caller until the climax of the event. Entrapment was relayed to responding units, however, the source reporting we had entrapment (caller inside home) was not relayed until late in the response after the arrival of Engine 6. Reports of entrapment has to verified upon our arrival before making an entry into an IDLH atmosphere. A caller inside the home reporting "I am trapped" is a guarantee of entrapment requiring immediate intervention and should have been relayed sooner to responding crews.

In addition, the intake matrix should have been deviated from much sooner, with the focus of the intake dispatcher shifting to encouraging the trapped occupant to get out of the house or at least to a door to assist in her rescue. Several items were discussed during the intake call that were not overall important to the mitigation of the scene. I am confident the intake dispatcher followed her training matrix with the items discussed, but the occupant attempting to self-rescue on this call, or at least try, was extremely important.



## Communication Interface with Other Agencies:

N/A

## Lessons Learned:

### Things that went well:

Firefighting operations overall were successful. No firefighters were injured while working on the scene. The fire was extinguished as quickly as limited water resources and access would allow for this type of fire, which was well involved upon our arrival. Overhaul of the structure was a success, with no rekindle of fire within the structure. Preservation of the scene as a possible crime scene was successful and facilitated with the assistance of Polk County Sheriff's Office and The State Fire Marshal. Coverage zones of occupied units were covered per typical operational protocols with other units while this scene was being mitigated. No exposures were damaged, and the subsequent brush fire resulting from this structure fire was contained. All proper notifications to all authorities were made in a timely fashion.

Captain 23, Keith Sherouse, did an excellent job of having situational awareness of when this call came in. Engine 23 was already assigned to another call when this call came in. Captain 23's awareness and diversion of response to this call assisted in facilitating a more positive outcome overall and improved response time of the second Engine to arrive on the scene.

### Things that could have been done better:

The relay of exact information as it was received by dispatch to responding crews could have been more accurate, and relayed earlier in the response. Tactical decisions made by the first in Company Officer (Captain 6) should have been different. A courtyard lay 300' or more in length is not feasible for a search and rescue operation of an already partially involved structure. Crew members (Captain and Firefighter) should have exited the apparatus breathing air and headed to the structure with forcible entry tools. Awaiting more personnel for a two-in, two-out rescue, although safer, was not necessary in this situation because of the report of entrapment. A more thorough examination of the structure should have been performed by walking around all sides of the structure except where the power line had fallen, to verify any possible routes remaining of ingress and egress.

Evidence does clearly show this structure was heavily involved fire, filled with smoke, and dangerous in every way to responders. However, review of the intake call and examination of the structure reveals that most likely a majority of the initial fire was in the attic, or attic spaces, above the occupant's head. Fire and smoke was coming out of every opening in the structure at ceiling level and above. The possibility does exist there was a very short period of time when the living space of the home could have still be entered by responders and a rescue *attempt* made. It must also be stated though that due to the escalation of the fire at this point, the chances of this rescue attempt being successful was improbable, and a high probability existed that this incident could have claimed the lives of two firefighters if they became disoriented in the smoke or if the structure collapsed while they were inside. In addition, this attempt at a

rescue would have been performed without a charged hoseline in place, or a backup up team to assist in the egress or rescue of these firefighters had they become compromised in their rescue attempts. Overall this emergency event represents the highest level of danger a responding firefighting crew can face.

Inexperience did play a part in the initial response and command structure of this event. The Captain and Firefighter are both inexperienced, and are a fair representation of the experience of Polk County Fire Rescue overall due to our recent rapid growth. A fire of this magnitude, coupled with the logistical and geographical challenges, along with the entrapment of a human, was overwhelming to this inexperienced crew and would overwhelm many others in this same situation. The Captain also displayed a lack of knowledge of the OSHA's two-in, two-out rule, and the allowance under this rule to execute a rescue without a back-up team in place. This did play a part In the Captain's decision whether or not to enter the structure.

Furthermore it should be noted, a decision was made not to take Tender 6 to this incident by Captain 6, because that would have otherwise occupied the firefighter and delayed response. This was the right decision, however, it does compromise water supply and places an equally difficult issue on the tactical decisions of the first in Captain, as well as subsequent responding Chief Officers. Engine 6, like most other County engines, has three personnel assigned to it. This manpower is simply not enough in a remote zone like Battalion One (North Lakeland) to facilitate proper and safe rescues of trapped persons and bring our own water supply, especially on incidents that are so far from the station.

An area for global training and improvement:

N/A

## Additional

Identified need for improved resources:

- Four person crews to facilitate the crucial emergency actions necessary by first-arriving fire apparatus. Until this manpower level is achieved, rescue of those trapped in structure fire situations will be nearly impossible, especially for those individuals who are unable to ambulate.
- Increased departmental training for our Engine Captains emulating extreme emergency situations.
- Increased personnel in the Battalion One zone including but not limited to Engines, Rescues, and better station placement. Every zone in Battalion One is left extremely compromised when the primary Engine for that zone responds to a medical call or motor vehicle crash, especially if they are already on scene of said event and committed.
- Tenders should be staffed, so as not to pull away from the manpower on the engine for water supply needs. Our water supply needs on this emergency call downed the staffing levels of three other County Engines that night, setting the stage for a duplicate disaster in another zone.
- Hydrants in the unincorporated areas of North Lakeland.
- Better Public Safety programs to educate citizens on the need for proper, visible street addressing visible during the day and night. In addition, better Public Safety programs to educate citizens on the need for clear and unobstructed access to their residence to facilitate emergency mitigation by responders.

















Live FireRECORDS

# Incident Report

<b>Incident Number:</b> 1887368	<b>Number of Alarms:</b> 1	<b>Date:</b> 11/23/2018	<b>Time:</b> 19:06
<b>Shift:</b> B	<b>District:</b> 1131A	<b>Exposure:</b> 000	<b>Station:</b> 06
<b>Alarm Time:</b> 11/23/2018 19:06	<b>Arrival Time:</b> 11/23/2018 19:22	<b>Controlled Time:</b> 11/24/2018 03:16	<b>Cleared Time:</b> 11/24/2018 07:48

### Incident Address

<b>Dispatch Address:</b> 13802 ROCKRIDGE RD	<b>Actual Address:</b> 13802 ROCKRIDGE RD	<b>Address Type:</b> 1 - Street address
<b>Property Use:</b> 419 - Single Family Dwelling	<b>Insurance Carrier:</b>	<b>Common Name:</b>
<b>Latitude:</b>	<b>Longitude:</b>	<b>Phone:</b>

### Incident Classification

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

<b>Incident Type as Dispatched:</b>	1 - Fire
<b>Actual Incident Type:</b>	111 - Building fire
<b>Mutual Aid:</b>	1 - Mutual aid received
	<b>FDID:</b> 05102
	<b>State:</b> FL
	<b>Incident Number:</b> 1887368
<b>Hazardous Materials Release:</b>	N - None

### Actions Taken:

11 - Extinguishment by fire service personnel	76 - Provide water
12 - Salvage & overhaul	81 - Incident command
14 - Contain fire (wildland)	82 - Notify other agencies.
21 - Search	86 - Investigate
24 - Recover body	

<b>Value - Property:</b> 250000	<b>Contents:</b> 100000	<b>Loss - Property:</b> 250000	<b>Contents:</b> 100000
---------------------------------	-------------------------	--------------------------------	-------------------------

### Authorities

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

<b>Member Making Report:</b> 11286	<b>Officer In Charge:</b> 0838
<b>Other Authorities:</b>	<b>Report Completed:</b> Yes

<b>Member Name:</b>	<b>Role:</b>
---------------------	--------------

### Incident Persons Involved

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone,



Elsa

**Person Involved:**

**Name:** Lorretta K Pickard

**Address:**

13802 Rockridge RD

**Date Of Birth:**

**Gender:** 2 - Female

**Race:** 1 - White

**Ethnicity:** 0 - Non Hispanic or Latino

**Involvement:**

**Business:**

**Incident Property**

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

**Area Of Origin:** UU - Undetermined

**Heat Source:** UU - Undetermined

**Item First Ignited:** UU - Undetermined

**Material First Ignited:** UU - Undetermined

**Cause of Ignition:** 2 - Unintentional

**Buildings:**

**Residential Units:** 1

**Acres Burned:** 1.0

**On Site Materials:**

Human Factors	Factors Contributing to Ignition	Fire Suppression Factors
5 - Physically disabled	UU - Undetermined	438 - Power lines down/arcing
N - None		443 - Poor access for firefighters
<b>Age:</b> 76		531 - Water supply inadequate: private
<b>Gender:</b> 2 - Female		

**Incident Structure**

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

**Structure Type:** 1 - Enclosed building

**Status:** 2 - In normal use

**Item Contributing to Flame Spread:** 17 - Structural member or framing

**Material Contributing to Flame Spread:** 63 - Sawn wood, including all finished lumber

**Fire Spread:** 4 - Confined to building of origin

**Main Floor -**

**Length:** 0

**Width:** 0

**Area:** 3000

**Story of Origin:** 1

**Floors Below Grade:**

**Floors Above Grade:** 1

**Floors Damaged -**

**Minor:**

**Significant:**

**Heavy:**

**Extreme:** 1

**Total:**

**Incident Personnel**

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

Personnel ID	Last Name	First Name	Rank / Position
26593	Gonzalez	Manuel	FF
11286	Williams	James	CAPT
22403	McMorrow	Kelly	FF
26653	Moerch	Nicholas	FF
0838	Gilley	Jeremiah	BC
4710	Gorokhov	Yevgeniy	BC
4851	Forbes	Alfred	FF



26596	Green	Timothy	FF
18418	Quinn	Courtney	CAPT
5042	Culpepper	Kevin	EN
4851	Forbes	Alfred	FF

### Personnel Actions Taken

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

<b>Action</b>
1 - Fire Control or Extinguishment
11 - Extinguishment by fire service personnel
12 - Salvage & overhaul
21 - Search
24 - Recover body
55 - Establish safe area
73 - Provide manpower
76 - Provide water
81 - Incident command
82 - Notify other agencies.
84 - Refer to proper authority
86 - Investigate

### Incident Apparatus and Resources

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

Unit ID	Dispatched	En-route	Arrival	Cleared Scene	Arrive Facility	Cleared Facility	In Service	In Qtrs
EN006	11/23 19:08	11/23 19:10	11/23 19:22			11/24 05:14		11/24 05:14
BC003	11/23 19:08	11/23 19:10	11/23 19:29			11/24 04:46		11/24 04:46
MR006	11/23 19:08	11/23 19:08	11/23 19:27			11/24 04:26		11/24 04:26
BC001	11/23 19:08	11/23 19:10	11/23 19:29			11/24 04:47		11/24 04:47
SQ007	11/23 19:08	11/23 19:08	11/23 19:30			11/24 04:24		11/24 04:24
EN039	11/23 19:08	11/23 19:09	11/23 19:35			11/24 04:40		11/24 04:40
EN023	11/23 19:15	11/23 19:16	11/23 19:26			11/24 04:45		11/24 04:45
TE039	11/23 19:13	11/23 19:13	11/23 19:37			11/24 04:40		11/24 04:40
TE004	11/23 19:53	11/23 19:54	11/23 20:45			11/24 07:48		11/24 07:48
BR023	11/23 19:55	11/23 19:55	11/23 19:55			11/24 05:17		11/24 05:17
AT019	11/23 19:38	11/23 19:45	11/23 20:48			11/24 04:29		11/24 04:29
MD231	11/23 19:36	11/23 19:36	11/23 19:55			11/24 04:15		11/24 04:15

FC506	11/23 21:18	11/23 21:18	11/23 22:17			11/23 23:50		11/23 23:50
TE015	11/23 19:53	11/23 19:53	11/23 20:30			11/23 22:59		11/23 22:59
TE006	11/23 19:24					11/23 19:34		11/23 19:34

### Apparatus Actions Taken

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

<b>Action</b>
11 - Extinguishment by fire service personnel
12 - Salvage & overhaul
14 - Contain fire (wildland)
21 - Search
24 - Recover body
31 - Provide first aid & check for injuries
73 - Provide manpower
74 - Provide apparatus
76 - Provide water
81 - Incident command
82 - Notify other agencies.
84 - Refer to proper authority
86 - Investigate
93 - Cancelled

### Incident Civilian Casualty

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

<b>Civilian Casualty:</b>		
<b>Name:</b> Lorretta K Pickard		
<b>Address:</b> 13802 Rockridge RD		
<b>Date Of Birth:</b>	<b>Gender:</b> 2 - Female	
<b>Race:</b> 1 - White	<b>Ethnicity:</b> 0 - Non Hispanic or Latino	
<b>Date and Time of Injury:</b> 11/23/2018 00:00		
<b>Affiliation:</b> 1 - Civilian	<b>Disposition:</b> N - Not transported under EMS	<b>Cause of Injury:</b> 1 - Exposed to fire products
<b>Severity:</b> 5 - Death	<b>Primary Apparent Symptom:</b> 11 - Burns and smoke inhalation	<b>Primary Part of Body Injured:</b> 9 - Multiple Parts
<b>Activity When Injured:</b> 7 - Unable to act	<b>Location at Time of Incident:</b> 2 - Not in area & not involved	<b>General Location at Time of Injury:</b> 2 - In building, but not in area of origin
<b>Specific Location at Time of Injury:</b> 14 - Common room, den, family room, living room, lounge	<b>Story at Start:</b> 1	<b>Story Where Injured:</b> 1

**Human Factors:**  
6 - Physically disabled

**Factors Contributing To Injury:**  
23 - Vision blocked or impaired by smoke  
41 - Roof collapse

**Incident Narrative**

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

**Title: Engine-6**  
**Narrative Text:**

**Type: 1 - Incident**

**Author: James Williams**

EN06 arrived on scene of a structure that was located approximately 300ft off the main access road. Visibility of the structure upon arrival was not obtainable because trees covered the property, and tightly surrounded the home. First observation while attempting to complete a 360 of the incident was a medium size structure that appeared to have fire involvement on the alpha, bravo side that involved the interior, and extended through the roof which was signaling potential fire throughout the attic as smoke was exiting all four corners of the home. Yard debris, lighting and vegetation hindered a productive 360 of the home. Command was established and a power drop was requested . Command then gave the order to establish a court yard lay that would supply water back to the structure so a primary search could be completed. This would be accomplished by utilizing EN06. Command then requested confirmation from dispatch that the information received was from someone inside the home since conditions to enter were not possible without water and deteriorating quickly hindering any ability for firefighters to make entry. Seconds after information was requested the power line disconnected from the riser dropping across the driveway causing a electrical danger stopping any access to the delta side and confirmed complete involvement in the attic since the riser was attached on the alpha, delta corner. Prior to EN23 arrival on scene they were given direction that their assignment was to establish a water supply and to provide crew members for a primary search of a possible victim. Command determined that fire was rapidly spreading through the home and a search could not be performed. The home quickly became 100% involved which changed the tactics to defensive since a rescue was no longer achievable. Battalion Chief-1 arrived and was given a conditions, actions and needs report. Battalion Chief-1 took over command at this time.

**Title: BC003**  
**Narrative Text:**

**Type: 2 - Company**

**Author: Yevgeniy Gorokhov**

Battalion 3 (BAT3) arrived on a fire scene; initial command had been established by Engine 6



(EN6); during the follow up report EN6 advised that accountability was placed by EN6, BAT3 assumed the accountability role at the same time Battalion 1 (BAT1) assumed Command from EN6; all fire ground personnel were staged at the accountability area and deployed for assignments from the same area; Medic 231 (MD231) was assigned to set up rehab 20-30 feet away from the front bumper of EN6; vital signs were obtained on every firefighter that came in for recycle or rehab; Shift Duty Officer was notified, food and more water supplies were delivered on scene due to an extensive overhaul; everybody was accounted for at all times; no injuries were reported to Command or Accountability.

**Title: Engine 23**

**Type: 2 - Company**

**Author: Keith Sherouse**

**Narrative Text:**

EN23 arrived on scene with direction from command to establish a water source and provide manpower at the alpha side of the structure.

Captain-23 attempted to make a complete 360 of the structure to assist command with determining if there was the ability to gain access into the structure for from another point for a rescue attempt. The home was too heavily involved, upon EN23 arrival for any possibility of making entry. Command determined that the fire needed to redirect into a defensive mode. Battalion Chief -1 arrived on scene and took over command.

Engineer 23 was assigned water supply officer. No hydrant was located in the area and dump tank/Tender operations was utilized. Hydrant was established at Cypress Lakes sub division. Approximately 28,000 gallons of water was used to extinguish fire. Additional water was needed and Auburndale Fire was called for a mutual aid tender (T-421). Tender 421 supplied 9000 gallons of the water used.

Captain 23 was reassigned to Alpha Operations and defensive strategy continued while recycling crews through Accountability Officer until fire was extinguished and overhauled. All crew members cleared from scene by Command.

Engine 23 and Brush 23 returned to station out of service until units was refueled and refilled with water.

**Title: Squad 7/ Brush 23**

**Type: 2 - Company**

**Author: Garrett Parnell**

**Narrative Text:**

Squad 7 was dispatched to a report of a residential structure fire at the above location. SQ 7 was designated as the third arriving engine and was directed to supply EN 23 with water upon arriving on scene.

SQ 7 arrived on scene and made access to EN 23 down a long dirt driveway. SQ 7 crew supplied EN 23 with a section of 2 1/2" supply line. Command (Battalion1) ordered SQ 7 crew to back our unit out to the hard road and return to the scene on foot for further instruction.

Upon returning to the staging area, Command directed SQ 7 crew members to man Brush 23. BR 23 was sent to the East of the fire scene to check for exposures and control the brush fire started by the structure fire. Captain 7 was designated as "Charlie Division". Access was made to the assigned area and no structural exposures were found. Crews were not able to access the brush fire due to large trees and multiple fences. BR 23 returned to the staging area and "Charlie Division" was disbanded.

BR 23 was directed to return to the Alpha side of the structure and extend a line to extinguish spot fires on the charlie and bravo sides under the direction of "Alpha Division". After extinguishing the spot fires, crew members assisted with overhaul operations of the main fire structure. Crew members continued in this role until SQ 7 was cleared by Command.

**Title: E39**

**Type: 2 - Company**

**Author: Courtney Quinn**

**Narrative Text:**

Upon arrival E39 found structure fully involved. E39 pulled pre connect off of E23 and connected to courtyard lay for fire suppression. E39 provided man power for fire control and salvage and overhaul.

**Title: T39**

**Type: 2 - Company**

**Author: Courtney Quinn**

**Narrative Text:**

T39 provided dump tank and water for fire operations.

**Title: Battalion 1 (Incident Command)**

**Type: 1 - Incident**

**Author: Jeremiah Gilley**

**Narrative Text:**

Battalion 1 arrived on scene to find a working residential house fire. Battalion 1 had called for a power drop while en route to the scene. Captain 6 repeated the request to Dispatch again after he arrived on scene and identified a working structure fire. The home was located on an unpaved road in the woods and was heavily surrounded by pine trees. The working structure fire could not be seen from Rock Ridge Road. Initial responding crews had extreme difficulty locating the residence because of the secluded location, the lack of an address on Rock Ridge Road that could be seen visually, and the distance of the structure from the roadway. E-6, E-23, Battalion 3, and Rescue 6 were already on scene prior to my arrival. Command had been established, a courtyard lay fire attack line was deployed down the driveway to the structure, and crews were working to establish a water supply. Captain 6, as Command, had declared a defensive attack mode. The area does not have hydrants. The closest commercial hydrant is approximately 5 to 6 miles away. A water nursing operation was utilized between apparatus until a dump tank operation could be set up and utilized. Crew members were attempting to fight the fire defensively from the Alpha side (front) of the structure. Battalion 1 met up face to face with Battalion 3 and assigned him the function of Accountability of on scene personnel. Battalion 1 also met up with Command, ( Captain 6) and assumed Command from him after receiving a face to face C.A.N. report. A P.A.R. was performed. Captains and Firefighters, 4 personnel total initially, were located on the Alpha side and were designated Alpha Division for tactical operations. Alpha Division used a one and three quarter inch attack line, derived from the two and a half inch courtyard hose lay, for initial fire attack and for protection. Captain 23 performed a 360 walkaround of the structure to ensure a rescue attempt was not feasible. An energized power line was down on the Delta



side (right side) of the structure. Captain 23 reported very high heat conditions all around the structure and visual flames in every doorway and window of the house. Squad 7 arrived on scene shortly behind Battalion 1 and assisted with manpower and checking the area for other structures that may be exposed. They also performed recon. of the wooded area around the home because a brush fire had begun in many locations around the home.

Tenders 39, 4, and 15 also arrived with AFD Tender 421 to facilitate tender shuttle operations. Once an adequate water supply was established a second one and three quarter inch handline was put into use from the same two and a half inch courtyard lay. Alpha Division defensively attacked the fire from the Alpha side of the structure. The State Fire Marshal's Office was notified and briefed at this time. Once safe, and after most of the fire had been extinguished, crews began to enter the now collapsed structure and conduct a primary search. The State Fire Marshal's was again notified and asked to come enroute to the scene for fire origin and cause determination. Extensive overhaul was performed to ensure complete extinguishment of the structure. The primary search turned up one casualty inside the structure. The casualty had been the 911 caller who initially reported the fire. No further discoveries were made with secondary search. Extensive overhaul was performed throughout the night. Polk County Sheriff's Office crime scene responded to the address, along with additional resources from the State Fire Marshal's Office. Polk County Fire Rescue crews performed shift change and E-6 returned to assist with body removal and identification operations. The chimney of the home was pulled down because it had become a safety hazard. Once the PCSO and the State Fire Marshal's investigation was complete, the home was turned over to the owner of the property.

#### Equipment Used

**Incident:** 2018-1887368-000 Version 78 of 78 Saved On: 11/28/2018 11:25:07 AM by Migone, Elsa

<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 28000	<b>Description:</b> 28000 gallons of water used.	<b>Apparatus:</b> EN006
<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 750	<b>Description:</b>	<b>Apparatus:</b> EN023
<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 750	<b>Description:</b>	<b>Apparatus:</b> SQ007
<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 6000	<b>Description:</b>	<b>Apparatus:</b> TE004
<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 12500	<b>Description:</b>	<b>Apparatus:</b> TE039
<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 7500	<b>Description:</b>	<b>Apparatus:</b> TE015
<b>Type:</b> GAL - Estimated water used (gallons)	<b>Quantity:</b> 250	<b>Description:</b>	<b>Apparatus:</b> BR023

2470 Clower Lane  
PO Box 1458  
Bartow, Florida 33831-1458



PHONE: 863-519-7350  
FAX: 863-534-5650  
[www.polk-county.net](http://www.polk-county.net)

---

**FIRE RESCUE DIVISION**

**To:** Anthony Stravino, Fire Chief  
**From:** Jeff Calcutt, Battalion Chief  
**Reference:** Preliminary Timeline for Rockridge Road Fire  
**Date:** November 29, 2018

Captain James Williams was interviewed today about the Rockridge Road fatal fire and this is the preliminary timeline that he gave us during the interview. There will be a formal transcript of the interview provided to you at a later date.

19:08:41 All units dispatched to call (Engine 6 at the station)

19:10:05 Engine 6 responding (decision made by Captain Williams to not bring the tender due to possible entrapment because he wanted the firefighter on the engine to attempt a quicker rescue)

19:22:47 Engine 6 on scene after having a difficult time finding the structure. Engine 6 staged the truck at the opening of the driveway going into the house.

From this point, Captain Williams directs his engineer to do a courtyard lay down the driveway for fire attack and directs his firefighter to follow him to the structure to evaluate the fire and attempt a rescue if possible.

Captain Williams stated that there were heavy fire conditions on the Bravo/Charlie side of the structure that included the door area where access would need to be made to enter the house. Captain Williams then proceeds to move to the left attempting to find another access point into the house. He is unsuccessful in going around back due to the fire conditions on the Charlie side. As he attempts to move back towards the alpha side, the power line drops from the alpha/bravo corner of the house. This power line is energized and blocks their attempt to move around the right side of the house. Access into the house is blocked by heavy fire at the bravo side door and a live power line down on the alpha/bravo corner. It is at this point that they assist the engineer with finishing the courtyard lay to start fire attack.

19:26:30 Engine 23 arrives on scene. Captain 23 tries to make access to the house but is unsuccessful.

19:27:05 Caller is screaming and on fire. There is no more contact with the caller after this point.

19:27:36 Defensive attack is announced.

19:27:38 Rescue 6 on scene.

19:29:21 Battalion 1 on scene and assumes command after a face to face with Captain 6.



Detailed History for Fire Event #S183271612 As of 11/26/2018 07:59:04

Output for: F2455

Priority:E1 Signal:69E06 - RESIDENTIAL(SINGLE)

Location:13802 ROCKRIDGE RD, LKN btwn JEH RD and STONE RIDGE LN [Route Map It](#)

<b>Created:</b>	11/23/2018 19:06:54	CTR42	8420
<b>Entered:</b>	11/23/2018 19:07:31	CTR42	8420
<b>Dispatch:</b>	11/23/2018 19:08:41	CDP7	7890
<b>Enroute:</b>	11/23/2018 19:08:51	PS0210	F25684
<b>Onscene:</b>	11/23/2018 19:22:47	CDP1	7263
<b>Control:</b>	11/24/2018 03:16:27	CDP1	7263
<b>Closed:</b>	11/24/2018 07:48:11	CCP13	7522

ICUnit:BC001 PrimeUnit:BR006 Dispo:COM Signal:69E06 - RESIDENTIAL(SINGLE)  
Agency:PCFR District:TC8(WEST) Zone:120 RD:1131A  
Case #:FS180087368

XREF::Sheriff Event:[#S183271693](#) Signal:S7 Agency:PCSO  Detail

- 19:06:54 CREATE Location:13802 ROCKRIDGE RD, LKN Signal:69  
Phone:863/272-2226 District:WEST Beat:1131A  
SigDesc:STRUCTURE FIRE LocDesc:btwn JEH RD and  
STONE RIDGE LN Priority:PA Response:3EBMD  
Agency:PCFR LocType:S
- 19:06:54 ALI E911Phne:863/272-2226 E911Add:14600 ROCKRIDGE  
RD SW SEC, XX E911Srce:WRLS
- 19:07:31 ENTRY
- 19:07:31 -NPREMS Comment:(NONE)
- 19:07:38 SELECT
- 19:07:55 CHANGE Name:None-->PIKKARD,LORETTA Contact?:None-->Y
- 19:08:01 PROQA Case#:4223034 Comment:CC text: Structure Fire  
Caller Statement: REPORTED BUILDING/STRUCTURE  
FIRE
- 19:08:25 PROQA Case#:4223034 Classify:69E06 Comment:CAD  
Response: EN/BC/ALS  
Dispatch Code: 69E06 (Residential (single))  
1. The incident involves a single-family residential  
structure.
- 19:08:27 CHANGE Signal:69-->69E06 Priority:PA-->E1  
SigDesc:STRUCTURE FIRE-->RESIDENTIAL(SINGLE)  
Comment:Fire ProQA recommends dispatch at this  
time

19:08:41 DISP **EN006** Operator:F7100 F7390 F18802  
 OperNames:WALSH,DEREK; GARTRELL,MARY;  
 DURANTE,ALEXANDER

19:08:41 DISP **EN039** Operator:F18821 F23251 F26596 F18418  
 F4851 OperNames:MOLNAR,ANDREW;  
 BROWN,MATTHEW; GREEN,TIMOTHY;  
 QUINN,COURTNEY R; FORBES,ALFRED

19:08:41 DISP **SQ007** Operator:F5019 F20852 F13421  
 OperNames:PARNELL,GARRETT; MUSICK.JUSTIN;  
 SHEEHAN,BRITNEY

19:08:41 DISP **BC001** Operator:F0838  
 OperNames:GILLEY,JEREMIAH

19:08:41 DISP **MR006** Operator:F26731 F26728 F22403 F25642  
 F25684 OperNames:SYDENSTRICKER,JONATHAN;  
 ABELARD,CARL; MUTIS,KELLY;  
 STEPHENSON,PATRICK; WINTZ,DANIEL

19:08:41 DISP **BC003** Operator:F4710  
 OperNames:GOROKHOV,YEVGENIY

19:08:41 -PRIU **EN006**

19:08:41 -CASE **EN006** Case#:FS180087368

19:08:41 -HOLD

19:08:51 \*ENRTE **MR006**

19:08:54 PROQA **Case#:4223034 Classify:69E06 Comment:CAD**  
 Response: EN/BC/ALS  
 Reconfigure Code: 69E06 (Residential (single))  
 Suffix: R (Trapped person(s))  
 2. A single-level structure is involved.  
 3. Someone is trapped inside the structure.

19:08:59 \*ENRTE **SQ007**

19:09:00 CHANGE **Comment:Fire ProQA reconfigured classification**

19:09:11 \*ENRTE **EN039**

19:09:15 REDIR **District:WEST-->TC8**

19:10:05 ENRTE **EN006**

19:10:07 PROQA **Case#:4223034 Classify:69E06 Comment:4. One person**  
 is trapped.  
 5. The location is: living room



6. The exact location of the fire is: poss roof  
 7. No one is reported to be injured.

19:10:09 CHANGE **District:TC8-->WEST Comment:Fire ProQA Key Questions**

19:10:13 \*ENRTE **BC003**

19:10:32 INFO **Comment:EITHER BACK DOOR OR FRONT DOOR**

19:10:35 REDIR **District:WEST-->TC8**

19:10:55 INFO **Comment:PT IS ON A WALKER AND CAN'T MOVE AS QUICKLY**

19:10:58 ENRTE **BC001**

19:11:12 INFO **Comment:RP ADV THAT HER LUNGS ARE FILLING UP WITH SMOKE**

19:12:06 INFO **Comment:RP ADV THAT SOMETHING SEEMED TO SPLASHED ON HER HEAD**

19:13:14 DISPER **TE039**

19:14:54 REQUEST **Rtype:HCP ReqReason:MEDICAL -Company:LN5 - Location:13802 ROCKRIDGE RD, LKN**

19:14:57 INFO **Comment:RP ONLY ADV THAT SMOKE IS IN THE HOME BUT SHE CAN'T SEE ANY FLAMES**

19:15:12 INFO **Comment:RP ADV THAT THIS IS A LOG HOME WITH TIN ROOF**

19:15:40 MISC **Comment:TOT LAKELAND ELECTRIC /SB7890**

19:15:58 DISP **EN023 Operator:F3921 F1204 F18729 OperNames:SHEROUSE,KEITH; JONES,JOE; HARRIS,LEE**

19:16:01 ENRTE **EN023**

19:18:19 INFO **Comment:RP ADV THAT IT IS HARD FOR HER TO GET UP W/O ASSISTANCE**

19:18:29 NOTIFY **Notified:LIFENET ON STANDBY//JH7339**

19:19:01 INFO **Comment:RP IS WORRIED SHE CAN'T GET UP WHILE HAVING THE PHONE IN HER HAND**

19:22:38 INFO **Comment:RP ADV THAT HER DOOR IS UNLOCKED**

19:22:47 ONSCN **EN006 Comment:LARGE RESIDENTIAL STRUCTURE FIRE,WORKING FIRE, LAST DRIVEWAY BEFORE THE BRIDGE**

19:22:52 IC **EN006 IUnit:EN006**

19:23:12 INFO **Comment:RP ADV THAT SHE CAN'T SEE ANYTHING IN THE HOME DUE TO THE SMOKE**



19:23:52 NOTIFY **Notified:SIG PAGE**  
 19:24:27 DISP **TE006**  
 19:24:33 MISC **Comment:HEAVY FLAMES AND SMOKE,SETTING UP A COURTYARD LAY FOR DEFENSIVE ATTACK**  
 19:24:53 MISC **Comment:ACCOUNTABILITY ON THE ALPHA SIDE OF THE ENGINE**  
 19:26:21 INFO **Comment:RP IS IN THE DINING ROOM STILL**  
 19:26:30 ONSCN **EN023**  
 19:26:43 INFO **Comment:RP SEES FIRE NOW**  
 19:26:51 MISC **Comment:HALF INVOLVED AT THIS TIME**  
 19:26:53 INFO **Comment:RP IS PANICKING**  
 19:27:05 INFO **Comment:RP IS SCREAMING**  
 19:27:36 MISC **Comment:DEFENSIVE ATTACK**  
 19:27:38 \*ONSCN **MR006**  
 19:27:42 ONSCN **MR006**  
 19:28:03 INFO **Name:PICKARD,LORETTA Contact?:Y Comment:RP IS NO LONGER RESPONDING TO X37**  
 19:28:20 INFO **Comment:X37 HEARS FIRE CRACKILING BUT NO RESPONSE**  
 19:29:21 ONSCN **BC001**  
 19:29:50 ONSCN **BC003**  
 19:30:12 \*ONSCN **SQ007**  
 19:30:46 INFO **Comment:RP STILL NOT RESPONDING TO X37**  
 19:30:56 CHANGE **District:TC8-->WEST Comment:Fire ProQA processing complete**  
 19:30:59 INFO **Comment:STILL LL**  
 19:31:54 REDIR **District:WEST-->TC8**  
 19:32:07 MISC **Comment:POWER LINE DOWN ON THE DELTA SIDE OF THE STRUCTURE**  
 19:33:23 ICX **EN006**  
 19:33:27 IC **BC001 ICUnit:BC001**  
 19:33:47 DISP **TE422**  
 19:34:03 CLEAR **TE006 Dispo:COM**  
 19:34:26 MISC **Comment:LKLD ELECTRIC JUST ARRIVED**  
 19:34:42 ENRTE **TE422**

19:35:40 ONSCN **EN039**  
 19:36:54 DISPER **MD231** Operator:F26999 F26883  
 OperNames:BENTZ,ERIC; DELUCIA,DEVIN  
 19:37:02 INFO Comment:LINE DEAD NOW//NO FURTHER RESPONSE  
 19:37:10 NOMORE  
 19:37:21 ONSCN **TE039**  
 19:38:31 DISP **AT019** Operator:F26422  
 OperNames:PEREZ,ANDREW  
 19:39:24 MISC **MD231** Comment:TAKING FF ON 231 AND PLACING  
 THEM ON BR023  
 19:39:31 MISC Comment:POWER SECURED  
 19:39:43 MISC Comment:MEDIUM SIZED WOOD FRAM STRUCTURE,  
 FULLY INV,DEFENSIVE MODE AT THIS TIME, POWER  
 LINE DOWN ON DELTA SIDE,NO ACCESS TO FIRE  
 TRUCKS DOWN THIS ROAD,COURTYARD LINE LAID  
 19:41:34 MISC Comment:CA006 ALPHA SIDE OPERATIONS  
 19:45:33 ENRTE **AT019**  
 19:50:02 -ASSOC Service:P Event:**#S183271693** Signal:LAW  
 Agency:PCSO Comment:LAW NEEDED FOR TRAFFIC  
 CONTROL  
 19:50:21 MISC Comment:FIRE STOPPED TO THE WOODS ON THE  
 BRAVO SIDE, HALF OF STRUCTURE COLLAPSED AT  
 THIS TIME, TRYING TO STOP FIRE FROM GOING TO  
 DELTA SIDE TO THE WOODS  
 19:50:35 ASSOC Service:P Signal:LAW-->S50  
 19:53:02 DISP **TE015**  
 19:53:02 DISP **TE004**  
 19:53:33 ENRTE **TE015**  
 19:54:03 ENRTE **TE004**  
 19:55:15 DISP **BR023**  
 19:55:18 ENRTE **BR023**  
 19:55:21 ONSCN **BR023**  
 19:55:55 \*ONSCN **MD231**  
 20:03:41 MISC Comment:STANDBYS PER BC007: EN028 - NORTH  
 LAKELAND / EN005 - ZONE 39 / EN017 - ZONE 5



- 20:04:54 ONSCN **TE422**
- 20:07:31 MISC **Comment:**GOOD KNOCKDOWN ON THE FIRE AT THIS TIME
- 20:16:52 MISC **Comment:**STILL IN DEFENSIVE TACTICAL OPERATION, STILL HEAVY FLAMES FROM THE STRUCTURE,STILL WORKING ON ESTABLISHING PERMANENT WATER SUPPLY,ALL PERSONNEL ACCOUNTED FOR, NO ADDITIONAL RESOURCES NEEDED EXCEPT FOR THE ONES RESPONDING
- 20:18:57 MISC **Comment:**BR023 BACK OUT ON THE HARD ROAD STAGING
- 20:19:20 MISC **Comment:**PAR 3 ON THE ALPHA SIDE
- 20:21:35 MISC **Comment:**DOLLAR STORE NEXT TO CIRCLE K ON WEST END WILL BE WHERE THE CLOSEST HYDRANT IS LOCATED
- 20:22:23 MISC **Comment:**CLOSEST HYDRANT IS BY CYPRESS LAKES
- 20:30:39 ONSCN **TE015**
- 20:42:42 MISC **Comment:**BC001 PHONE CONSULTED WITH SFM'S OFFICE, WILL CALL THEM BACK WHEN NEEDED TO RESPOND TO THE SCENE
- 20:44:18 MISC **Comment:**HYDRANT AT INTERSECTION OF BIG CYPRESS BLVD/FIRESTONE WAY,ON THE LEFT AS YOU COME IN
- 20:45:01 ONSCN **TE004**
- 20:45:36 MISC **Comment:**BRUSH FIRE CONTAINED ON ALPHA/BRAVO SIDE//SMALL BRUSH FIRE MAKING ITS WAY TO THE CHARLIE SIDE
- 20:48:00 ONSCN **AT019** **Comment:**PER AVL
- 20:48:09 CONTACT **BC001 EN006 AT019 BC003 BR023 EN023 EN039 MD231 MR006 SQ007**  
**Timer:300**
- 20:48:09 CONTACT **TE004 TE015 TE039 TE422** **Timer:300**
- 20:55:12 MISC **Comment:**PAR 5 ALPHA SIDE
- 21:18:16 MISC **Comment:**VERIZON: 1906 TOWER AT 14600 ROCKRIDGE RD DEVICE IS 1.31 MILES IN A SW DIRECTION: LAT 28.24620 LONG: -81.96320 SUBSCRIBER: LORETTA PICKARD 13802 ROCKRIDGE RD, LAKELAND
- 21:18:24 DISPER

**FC506** Operator:F2324 F0121  
 OperNames:VITTON,RAF; BALL,EVERETT  
 21:20:27 MISC Comment:LAT AND LONG SHOWING NEAR 13616  
 MICHELLE LEE LOP, LKN  
 21:22:24 MISC Comment:TE039 IS LEVEL ONE ON THE HARD ROAD  
 22:15:13 CLEAR **TE422**  
 22:17:03 ONSCN **FC506**  
 22:26:52 MISC Comment:CONFIRMATION OF ONE DECEASED IN THE  
 RESIDENCE  
 22:54:12 CONTACT **FC506** Timer:300  
 22:59:59 CLEAR **TE015**  
 23:50:43 CLEAR **FC506** Dispo:COM  
 [11/24/2018]  
 01:48:36 CONTACT **BC001 EN006 AT019 BC003 BR023**  
**EN023 EN039 MD231 MR006 SQ007**  
 Timer:300  
 01:48:36 CONTACT **TE004 TE039** Timer:300  
 03:16:27 OK **BC001 EN006 AT019 BC003 BR023**  
**EN023 EN039 MD231 MR006 SQ007**  
 03:16:27 OK **TE004 TE039**  
 03:16:40 MISC Comment:COMPLETING SAVAGE AND OVERHAUL  
 03:23:34 MISC Comment:EN036 MOVED TO STANDBY FOR POLK  
 CITY PER BC002 /SB7890  
 03:27:23 CONTACT **BC001 EN006 AT019 BC003 BR023**  
**EN023 EN039 MD231 MR006 SQ007**  
 Timer:60  
 03:27:23 CONTACT **TE004 TE039** Timer:60  
 04:15:47 CLEAR **MD231**  
 04:24:40 CLEAR **SQ007**  
 04:26:41 CLEAR **MR006**  
 04:29:09 CLEAR **AT019**  
 04:40:46 CLEAR **TE039**



04:40:51 CLEAR EN039  
 04:45:19 CLEAR EN023 Dispo:COM Comment:COM  
 04:46:15 CLEAR BC003  
 04:47:23 CLEAR BC001  
 04:47:23 -ICX BC001  
 04:50:33 MISC Comment:EN006 STAYING ONSCENE TO PRESERVE THE CUSTODY OF THE SCENE, FIRE MARSHALL COMING BACK OUT AT DAYLIGHT, A COUPLE OF DIFFERENT TRUCKS WILL ROTATE TO HELP PRESERVE THE CUSTODY OF THE SCENE  
  
 05:14:47 CLEAR EN006  
 05:17:23 CLEAR BR023  
 05:23:07 CONTCT TE004 Timer:150  
 05:48:00 CONTCT TE004 Timer:300  
 05:52:01 ASSOC Service:P Signal:S50-->S7  
 07:48:11 CLEAR TE004 Dispo:COM  
 07:48:11 -CLEAR  
 07:48:11 CLOSE  
 07:49:57 RO  
 07:49:59 SELECT  
 07:50:06 DISP BR006  
 07:50:06 -PRIU BR006  
 07:50:06 -HOLD  
 07:50:08 ONSCN BR006  
 07:50:19 CONTCT BR006 Timer:60  
 08:52:07 CONTCT BR006 Timer:60  
 09:41:41 BACKER EN006 UnitID:BR006 Location:13802 ROCKRIDGE RD, LKN Operator:F7100 F7390 F18802  
OperNames:WALSH,DEREK; GARTRELL,MARY; DURANTE,ALEXANDER  
  
 09:56:18 ONSCN EN006  
 09:56:43 CONTCT BR006 EN006 Timer:60  
 11:07:48 CONTCT BR006 EN006 Timer:60

12:09:43 CONTACT **BR006 EN006** Timer:90

12:52:14 CLEAR **BR006 EN006**

12:52:14 -CLEAR

12:52:14 CLOSE

CONTACT INFO:

Name	Phone	RPaddr	Contact?	Weapon?	ScnSafe?	CIT?
	863/272-2226					
PIKKARD,LORETTA			Y			
PICKARD,LORETTA			Y			



12:34:13 AIQ

16:02:35 DISP

**#S183271288** Signal:69C02 CallLoc:3519 VALLEY TRL, KAT

16:02:35 -PRIU

16:02:35 -CASE

Case#:FS180087333

16:02:53 ENRTE

16:14:14 ONSCN

16:25:00 OK

16:56:22 CLEAR

Signal:69C02

17:04:03 AIQ

19:08:41 DISP

**#S183271612** Signal:69E06 CallLoc:13802 ROCKRIDGE RD, LKN

19:08:41 -PRIU

19:08:41 -CASE

Case#:FS180087368

19:10:05 ENRTE

19:22:47 ONSCN

Comment:LARGE RESIDENTIAL STRUCTURE FIRE,WORKING FIRE, LAST DRIVEWAY BEFORE THE BRIDGE

19:22:52 IC

ICUnit:EN006

19:33:23 ICX

20:48:09 CONTCT

Timer:300

[11/24/2018]

01:48:36 CONTCT

Timer:300

03:16:27 OK

03:27:23 CONTCT

Timer:60

05:14:47 CLEAR

Signal:69E06

TS work copy



bing maps

**A** 13802 Rockridge Rd, Lakeland, FL 33809

10 min , 7.3 mi

**B** Polk County Fire Dept-Sta 6


Light traffic  
Via Rockridge Rd, US-98

Type your route notes here

**A** 13802 Rockridge Rd, Lakeland, FL 33809

- ↑ 1. Depart **Rockridge Rd** toward Jeh Rd 4.6 mi
- Turn **left** onto **US-98 / SR-35 / SR-700**
- ↙ 2. Shell on the corner 2.7 mi  
▲ *Minor Congestion*
- 3. Arrive at **US-98 S / SR-700 S / SR-35 S**  
If you reach W Dees Rd, you've gone too far

**B** Polk County Fire Dept-Sta 6

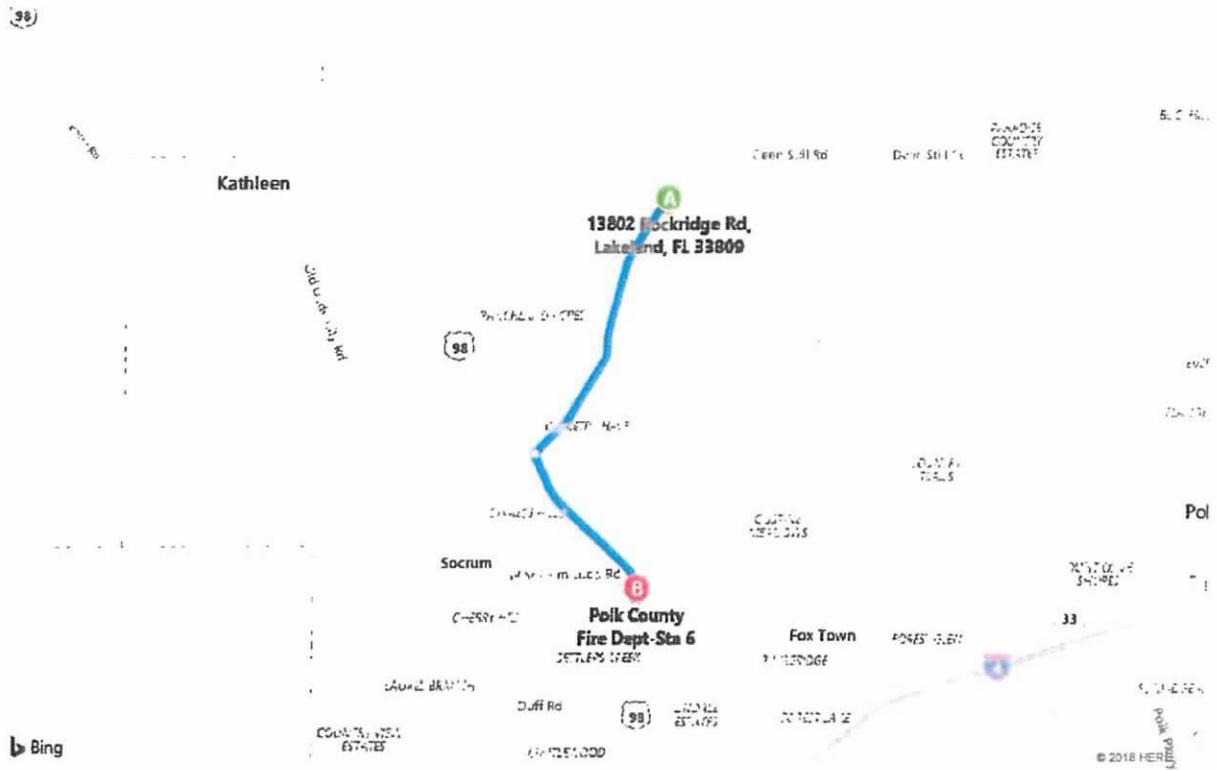

**A** 13802 Rockridge Rd, Lakeland, FL 33809


**B** Polk County Fire Dept-Sta 6



These directions are subject to the Microsoft® Service Agreement and are for informational purposes only. No guarantee is made regarding their completeness or accuracy. Construction projects, traffic, or other events may cause actual conditions to differ from these results. Map and traffic data © 2018 HERE™.

bing maps

Notes

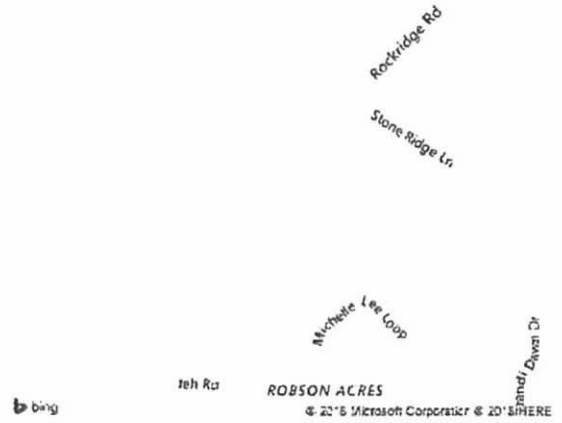






© 2014 Google

100 Feet  
50 m

> United States · FL · Polk Co. · Lakeland

Aerial

Rockride

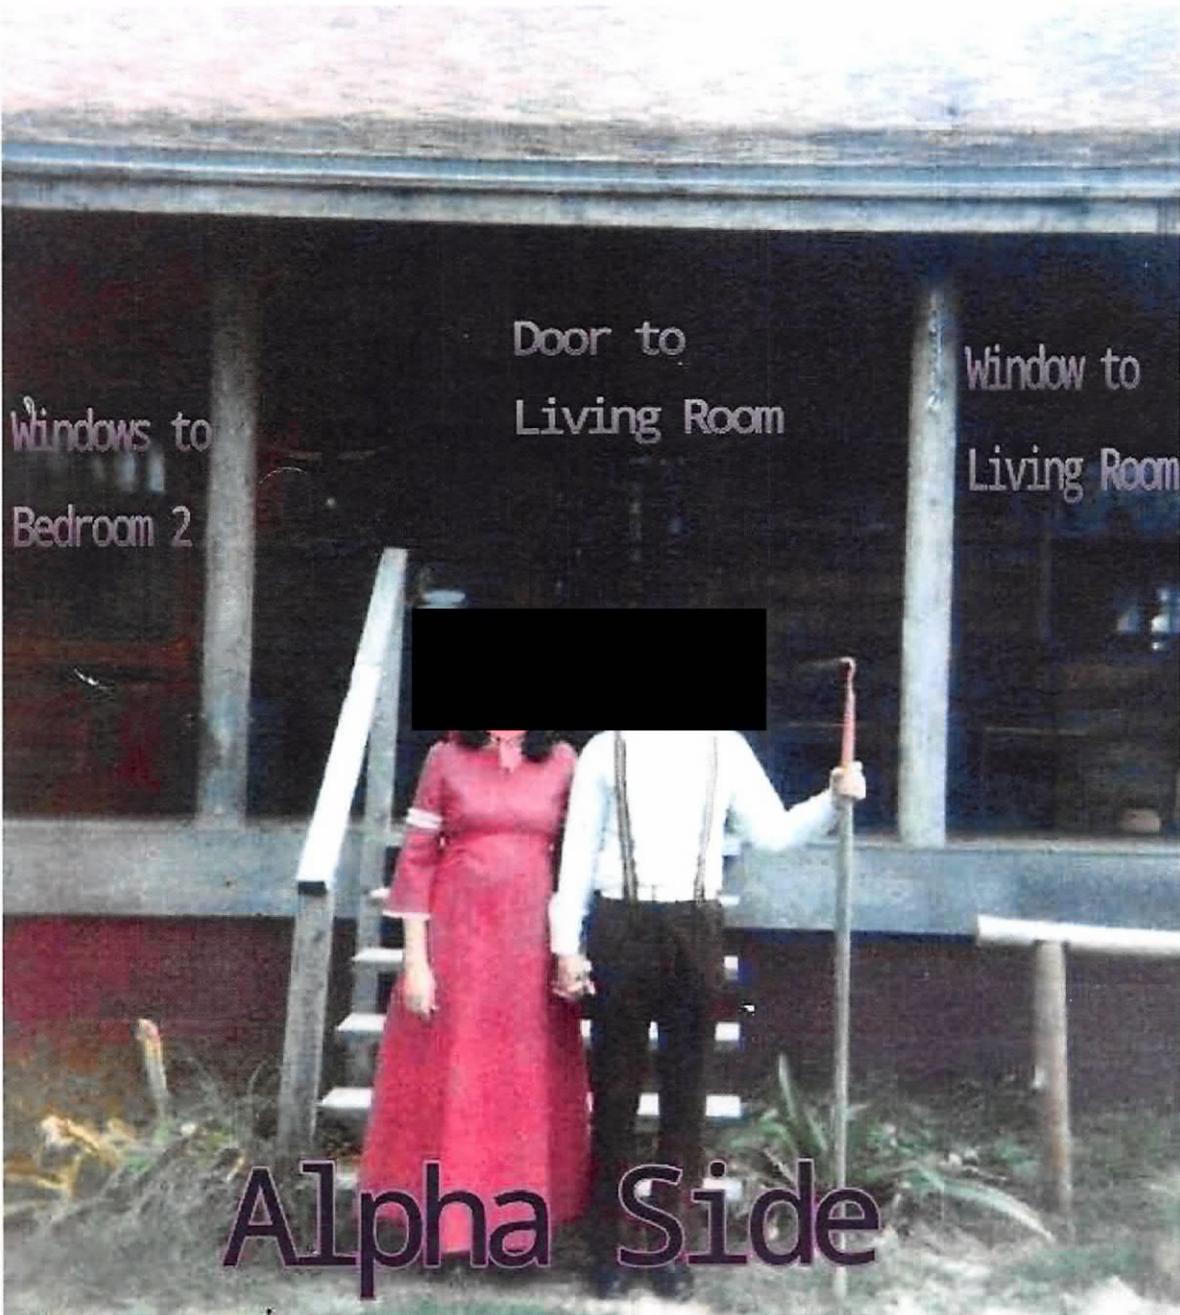

Windows to  
Bedroom 2

Door to  
Living Room

Window to  
Living Room


Alpha Side





Delta side of Porch



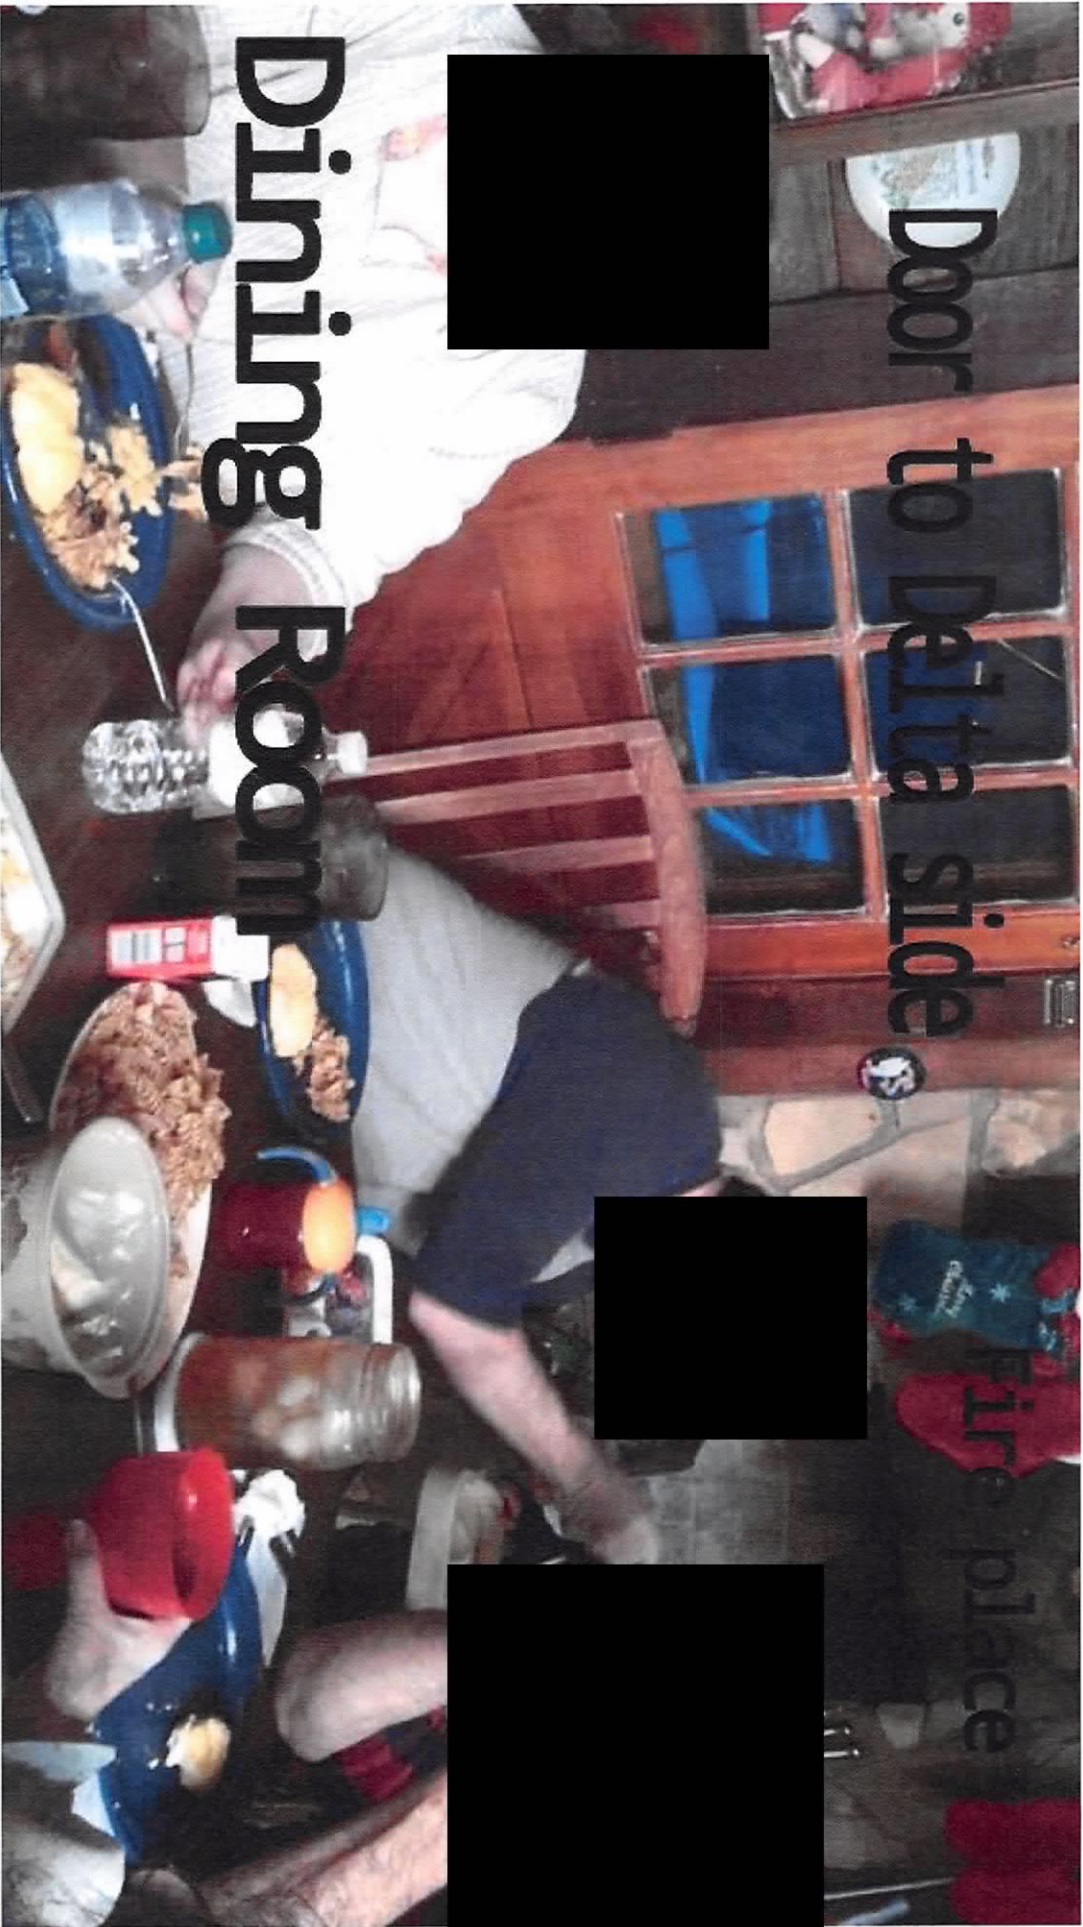

Door to Delta side

Dining Room

Fire place



Windows going to Charlie side

Dining Room



Alpha side of house





Staircase on  
Bravo Side

Alpha side of Porch